

# Service-Information Motorcycle



©BMW of N.A.  
Service Department

Group:

61  
General  
Electrics

August, 1992  
61 027 92  
(2548)

For USA Only

## Additional Ground Between Engine and Frame - R100R Models

**Problem:** Grounding between the engine and frame is not always reliable on silver-painted frames. This may lead to ignition misfiring or insufficient alternator output.

### Production

**Line Change:** Starting with VIN 0280227, a wire has been added from the starter motor cover to the ignition control unit mounting bracket.

**Remedy:** Install a ground wire to all affected R100R models with a VIN prior to 0280227.

The ground wire is secured to the left starter motor cover screw and the ignition control unit mounting bracket.

