

Service-Information



Group 13 Fuel Supply & Adjustment	May 1980	Bulletin No.: 13 003 80(2021)
--------------------------------------	-------------	----------------------------------


- For U. S. A. and Canada Only -

Subject: Air Intake Modification for all 1980 Models

Subsequent to the start of 1980 model production, it was discovered that a modification to the air filter housing top was beneficial to the air intake/carburetion systems.

All 1980 models should be checked to ascertain if this modification was performed during manufacture. If not, it should be performed by the dealer.

The modification consists of drilling four (4) holes in each air horn as indicated in the drawing below.

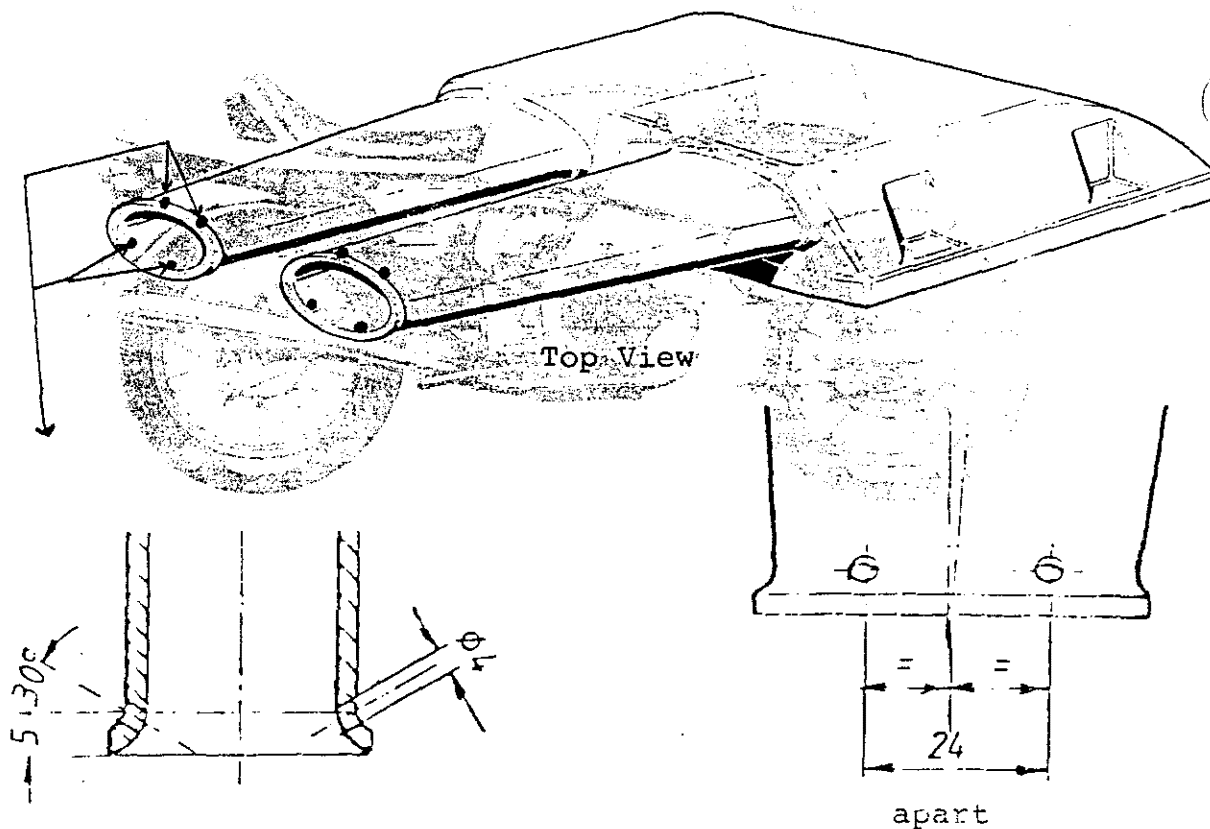

at a 30° angle
5 mm from the edge

Please route and initial before filing

	Parts Manager	Service Writer	Technicians
--	---------------	----------------	-------------

Bulletin No.: 13 003 80(2021)

Motorcycles lacking this modification may experience a mid-range flat-spot in the carburetion as the restricted air intake creates an overly rich condition in the combustion chamber.

Dealers performing this modification will be reimbursed 6 AW on submission of a completed warranty request form.

BMW MOTORRAD GMBH
After-Sales Service
Munich