



# SERVICE INFORMATION

tech. Customer Service  
KT 20 Gi/Zr/Go

Motorcycles R50/5, R60/5, R75/5  
group: el. equipment

Munich, Dec. 70  
No. 4/70 (299) eng.

Ref.: Re-fitting on fully interference cleared cycles

Dear Sirs,

in order to avoid that the left - in driving direction - carburettor bowden cable is pressed by the tank to the connection lug of the condenser, as a rule at the following fully interference cleared cycles please cover the bowden cable at this touching area:

model R 50/5	before	frame	No.	2 901 790
" R 60/5	"	"	"	2 932 689
" R 75/5	"	"	"	2 973 658

For this open approx. 100 mm fuel line at the entire length and put it at dismantled tank around the bowden cable; secure fuel line with tape Tesa black 651, 1,5 cm broad, against displacement.

Necessary work time: 4 FR.

Yours very truly,

BAYERISCHE MOTOREN WERKE  
Aktiengesellschaft  
ppa. i.V.

Delleske

Bennewitz

Kenntnis genommen - Pris connaissance - Noted - Tomado nota - Preso conoscenza					Ablage - Archives - File - Archivio		
Betriebsleitung Direction Management	Werkstatt Atelier Workshop	KD-Annahme Réception clientèle Cust. reception	Gewährh.-Sachb. Inspecteur garantie Warranty Inspector	E-Teildienst Service pièces détachées Spare parts service	Betriebsleitung Direction Management	Werkstatt Atelier Workshop	