

# Service-Information



BMW MOTORRAD GMBH Techn. Kundendienst R-VK-11 ma/ur	Motorcycles R90/6 - R90S Group: Engine	Munich, June 1978 11 006 78 (1045R)
---	---	--

-For U.S.A. and Canada Only-

Subject: Cylinder Head Locating

Dear Dealer,

Starting with


R 90/6	V.I.N.	4 961 244
R 90 S	V.I.N.	4 980 480

the countersink in the cylinder head and locating sleeve in the cylinder barrel

Part No. 11 11 1 258 311

are no longer manufactured.

At the same time, the head gasket corresponding holes were reduced to 10.5 - 11 mm diameter, all 6 holes are therefore identical.

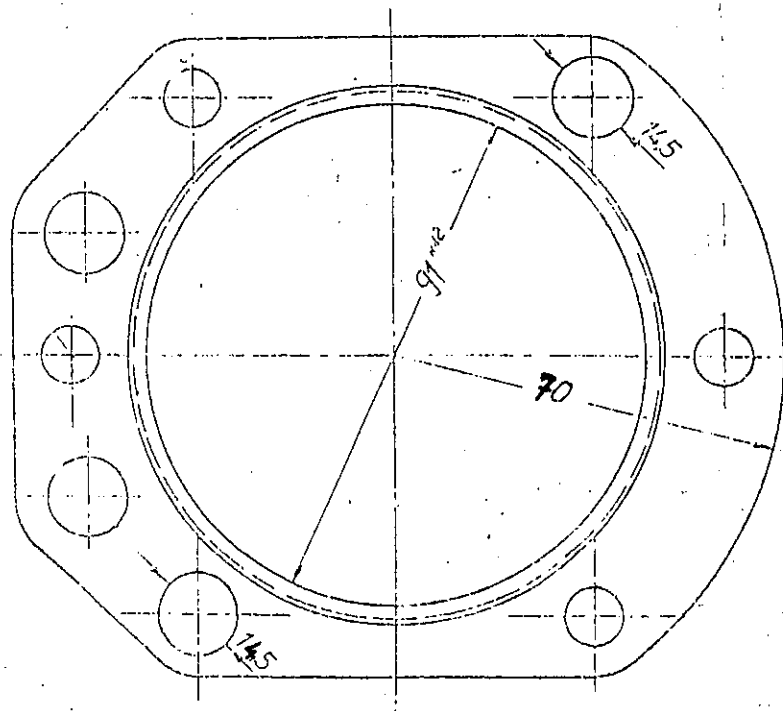

Kenntnis genommen - Pris connaissance - Noted - Tomado nota - Preso conoscenza				Ablage - Archives - File - Archivo		
Betriebsleitung Direction	Werkstatt Atelier	KD-Annahme Reception clientele	Gewährl.-Sachb. Inspecteur garantie	Teiledienst Service pieces detachees	Betriebsleitung Direction	Werkstatt Atelier

11 006 78 (1045R)

The older head gasket, as per drawing, is no longer available.  
The new gasket

Part No. 11 12 1 261 672


could be used as follows:

Heat up the cylinder to remove the locating sleeves or enlarge the corresponding holes from 10.5 - 11 mm to 14.5 mm.

See above drawing.

Yours truly,

BMW MOTORRAD GMBH  
Munich

i.v.  
  
Gonzalez

i.v.  
  
Blank