

Service-Information Motorcycle



©BMW of N.A.
Service Department

Group:

36
Wheels and
Tires

August, 1992
36 053 92
(2549)

For USA Only

Tire Valve Stem (Front Wheel) - R100R Models

Complaint: The surface of the rubber valve stem is torn or has scrap marks on it.

Problem: The hole in the rim has a sharp edge and can scratch the surface of the valve stem when pulled through.

Note: The scratches will only affect the surface of the stem. There is **NO** risk of sudden air loss.

Remedy: R100R models from VIN 0280001 to 0280190 may have burrs at the valve hole.

Since the tire valve should be replaced at every tire change, the valve hole can be inspected and deburred if necessary.

Part: Tire valve - 36 31 1 454 963

Warranty: Labor is reimbursable under the provisions of the BMW limited motorcycle warranty, using a normal warranty claim form.

Defect Code No.: 36 32 01 7700
Flat Rate No.: 36 99 000
Flat Rate: 1 FR = (5 min.)

Very truly yours,

BMW of North America, Inc.

Frank Stevens
National Service Manager
Motorcycle Group

Richard Dampf
National Technical Manager

FS:tb/174.7

Please initial and route to the following before filing

Service	Parts	Sales	Warranty	Technicians
---------	-------	-------	----------	-------------