

# Service-Information Motorcycle



BMW NA  
Service Department

Group: 16

October 1991

Fuel Tank  
and Lines

16 016 91  
(2486)

For USA Only


## Fuel Cap - All Boxer Models

This bulletin replaces S.I. #2244 dated July, 1987

**Condition:** The fuel cap chafes the painted surface of the tank at the filler neck.

**Cause:** The filler neck is welded too deeply into the fuel tank.

**Remedy:** Install an O-ring - part no. 62 16 1 459 608 - into the groove of the fuel cap seal. The O-ring makes the seal slightly thicker and the cap cannot be screwed in as far.

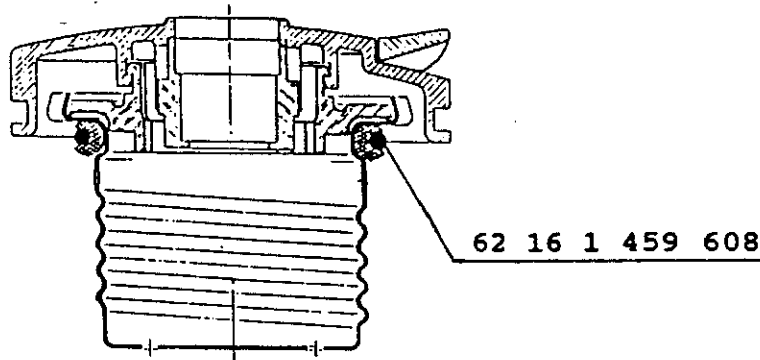

Please check new motorcycles for appropriate fuel cap fit.

Very truly yours,

BMW of North America, Inc.

Frank Stevens  
National Service Manager  
Motorcycle Group


Richard Dampf  
National Technical Manager

FS:jel/379.2

Please initial and route to the following before filing

Service	Parts	Sales	Warranty	Technicians
---------	-------	-------	----------	-------------

LOCKING TANG OF LOCK  
MUST GO IN ON THIS RAMP

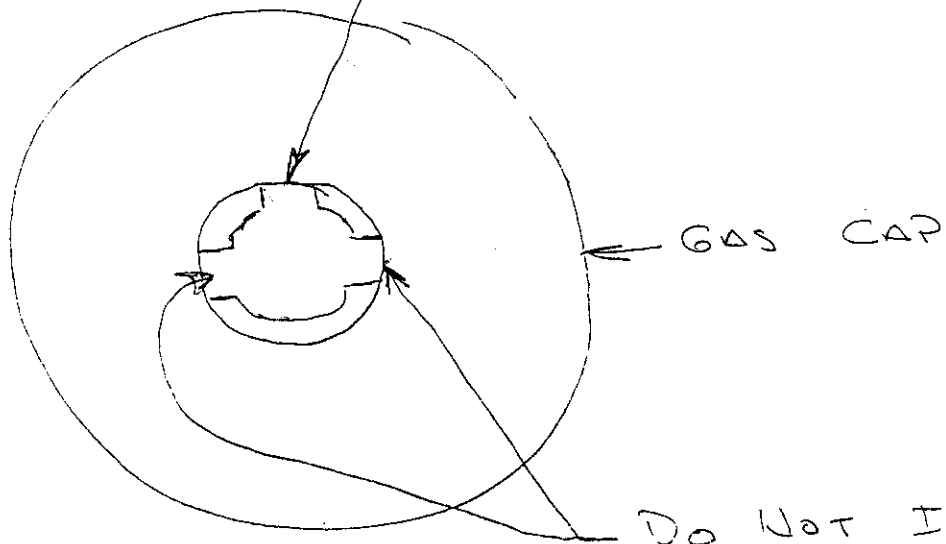

DO NOT INSERT  
LOCK DOWN THESE  
SIDE PIECES WITH  
THIN RIBS AT BOTTOM