

# Service-Information Motorcycle



BMW NA  
Service Department

Group: 62  
Instruments

March, 1988  
62 005 88  
(2295)


For USA Only

## Instrument Vibration - R Models

**Complaint:** Instrument vibration and Speedometer/Tachometer needles falling off.

**Note:** Pre-U.S. production R100RS motorcycles experienced this; all U.S. production motorcycles will have the updated mounts.

**Remedy:** The four (4) light-colored (Gray or White) rubber bushings, which the Instruments are mounted in, are now updated with **black** rubber bushings which are softer and therefore will absorb vibrations more effectively.

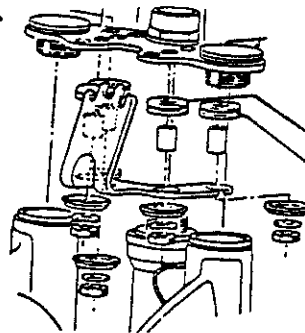

Part Nos.:  
31 42 1 232 244  
31 42 1 232 245  
(2 of each)

**Exchange:** During the course of servicing a European or Canadian R100RS motorcycle (early 1987 production), the light-colored rubber sleeves should be exchanged for the softer black sleeves.

**Warranty:** Use Defect Code Number 00 00 62 0100  
Flat Rate Units 7 (35 min.)

**Important Note:** On the R80 and R80RT the light-colored rubber sleeves are sufficient. However, for production reasons the black sleeves will be installed on all R models.

Warranty Claims for exchange of these rubber sleeves will only be accepted on R100 models.

Very truly yours,

BMW OF NORTH AMERICA, INC.

Frank Stevens  
National Service Manager

Richard Dampf  
National Technical Manager

je1/409.1