

Service-Information Motorcycle



BMW NA
Service Department

Group: 11
Engine

December, 1992
11 051 92
(2562)

For USA Only

Oil Cooler Line Hollow Screw Connection -- R100GS and R100R

Problem: Oil leak at the oil filter cover / oil cooler line.

Cause: When the oil filter was changed, the cooler hose connection may have been twisted causing the screw to slightly loosen. Subsequent tightening does not guarantee it will not leak again.

Remedy: During pre-delivery checks, tighten the connection to:

15 Nm + 5 Nm (11 ft./lb. + 3.5 ft./lb.)

If the connection has been released, it is essential to install 4 new sealing washers (P/N 07 11 9 963 130).

Tightening torque when new sealing washers are used is:

18 Nm + 2Nm (13 ft./lb. + 1.5 ft./lb.)

Very truly yours,

BMW of North America, Inc.

Frank Stevens
National Service Manager
Motorcycle Group

Richard Dampf
National Technical Manager

FS:tb/399.8

Please initial and route to the following before filing				
Service	Parts	Sales	Warranty	Technicians