

# Service-Information Motorcycle



BMW NA  
Service Department

Group: Group 33  
Rear Wheel  
Drive

January 1992  
33 017 92  
(2506)

For USA Only

## Rear Shock Adjustment Knob Numbering - R100GS 1991 Models


**Complaint:** The white numbers on the rear shock adjusting knob have a tendency to come off.

**Remedy:** Future adjusting knobs will have raised numbers. Replace the adjusting knob with:

Part No. 33 53 2 314 139

### Replacement

- Instructions:**
- Turn the knob to the maximum (position 10)
  - Using a center punch, put a mark on the plastic nut which is below the knob
  - Pry the knob off gently, using a screwdriver
  - Using a plastic hammer, drive the new adjusting knob on with the Figure 10 aligned with your center punch mark:

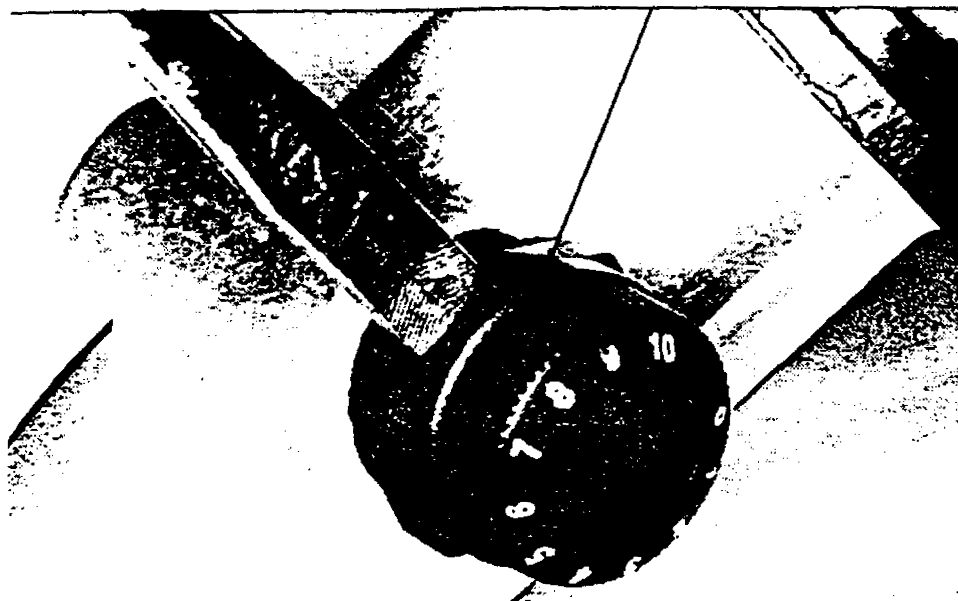

Please initial and route to the following before filing

Service	Parts	Sales	Warranty	Technicians

**Warranty**

**Status:** Parts and Labor are reimbursable under the provisions of the BMW Limited Motorcycle Warranty of Three (3) Years/Unlimited Miles, using a normal Warranty Claim Form.

Use Defect Code: 33 53 00 77 00

Use Flat Rate Code: 3399000

Use Flat Rate Units: 1

Very truly yours,

BMW of North America, Inc.



Frank Stevens  
National Service Manager  
Motorcycle Group



Richard Dampf  
National Technical Manager

FS:je1/103.3