

Service-Information



BMW MOTORRAD GmbH Service RM-K-11 da	Motorcycles: R65 - R100 RT Technical Group: Engine Electrical	Munich, July '79 12 002 79 (1071R)
--	---	---------------------------------------

- For U.S.A. and Canada Only -

Subject: Stiffer Contact Breaker and Change in Distributor For All 1979 Models

Dear Dealer:

A new contact breaker assembly (BMW Part # 12 11 1 243 969) is available in case a misfire occurs above 6500 engine rpms even if the timing and carburetion is correct.



Caution!! Due to the increased pressure of this contact breaker the lubrication of the felt must be increased.

The new distributor unit has also been improved as follows:

	New	Old
1. Breather Hose	∅ 10 mm, color white	∅ 8 mm, color black
2. Cover	with gasket	without gasket
3. Cover Mounting	with 2 screws	with 1 screw
4. Breather Holes (backside)	none	2, ∅ 6 mm
5. Contact Cable	black with white rings	black

Yours truly,

BMW MOTORRAD GmbH
Munich

i.V.  Gonzalez
 i.V.  Blank

Kenntnis genommen - Pris connaissance - Noted - Tomado nota - Preso conoscenza					Abiage - Archives - File - Archivo	
Betriebsleitung	Werkstatt	KD-Annahme	Gewährl.-Sachb.	Teiledienst	Betriebsleitung	Werkstatt