



# SERVICE INFORMATION

Customer Service  
V. GmbH/B&S. N.J.

Motorcycles R50/5, R60/5, R75/5 New Jersey, Nov. 1969  
Engine No. 1/69 (273)

Subject: Valve Timing

Gentlemen:

The valve timing information given in the owner's manual and repair manual is in error.

The valve timing is measured with a valve clearance of 2 mm. It is as follows:

R50/5 and R60/5

Intake opens TDC  
Intake closes 40° after BDC  
Exhaust opens 40° before BDC  
Exhaust closes TDC

R75/5

Intake opens 10° before TDC  
Intake closes 50° after BDC  
Exhaust opens 50° before BDC  
Exhaust closes 10° after TDC

Please correct the owner's manual on page 56 and the repair manual on page 11-06 accordingly.

Bayerische Motoren Werke  
Aktiengesellschaft

- Volker Beer -

Kenntnis genommen — Pris connaissance — Noted — Tomado nota — Preso conoscenza				Abiage — Archives — File — Archivo			
Betriebsleitung Direction	Werkstatt Atelier	KD-Annahme Réception clientèle	Gewdhrl.-Sachb. Inspecteur garantie	E-Teildienst Service pièces détachées	Betriebsleitung Direction	Werkstatt Atelier	