

Service-Information Motorcycle



BMW of N.A.
Service Department

Group: 23
Gear Box


June 1986
23 008 86
(2217)

For USA Only

Changes in 5-Speed Gear Box -- Boxer Models

Information:

The gear box output shaft no longer has the circlip groove machined into it. Through the use of a new style bearing, the circlip [2] and spacer [3] are no longer needed.

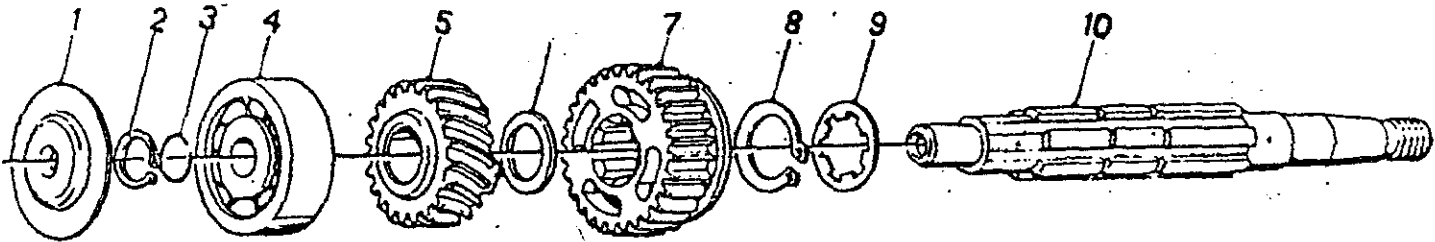

The ball bearing [4] inner race has changed in shape.

Note: It is acceptable to use this new style bearing on older output shafts and not use the circlip and spacer.

Very truly yours,

BMW OF NORTH AMERICA, INC.

Richard Dampf
National Technical Manager
Motorcycle Group

RD:ch/02-045