SERVICE INFORMATION

Tech. Cust. Service VKT 20 Gi/Zr/Go	Motorcycles R 50/5, R 60/5, R 75/5 Gr.: Suspension and shock absorbers	Munich, Jan. 71 No. 2/70 (293) e.

Ref.: Castor correction at the installation of shells

Dear Sirs,

when installing shells, the castor is smallered by the higher front axle boad and the greater spring way of the fork. To reach the original castor again, put each two washers, ordering No. 31 42 2 000 399 under the upper spring bearing of both fork legs, see chart.

The driving stability by this is kept constant at bikes with shells.

If you produce these washers by yourself use as material Aluminium, steel or oilproof plastics as Nylon, Pertinax or Novotex.

Yours very truly,

BAYERISCHE MOTOREN WERKE
Aktiengesellschaft
ppa. i.V.

Delleske Bennewitz

chart on
reverse side

Kenntnis genommen - Pris connaissance - Noted - Tomado nota - Preso conoscenza					Ablage - Archives - File - Archivo	
Betriebsleitung Direction Management	Werkstatt Atelier Workshop	KD-Annahme Réception clientèle Cust. reception	Gewährl.-Sachb. Inspecteur garantie Warranty inspector	E-Teildienst Service pièces détachées Spare parts service	Betriebsleitung Direction Management	Werkstatt Atelier Workshop

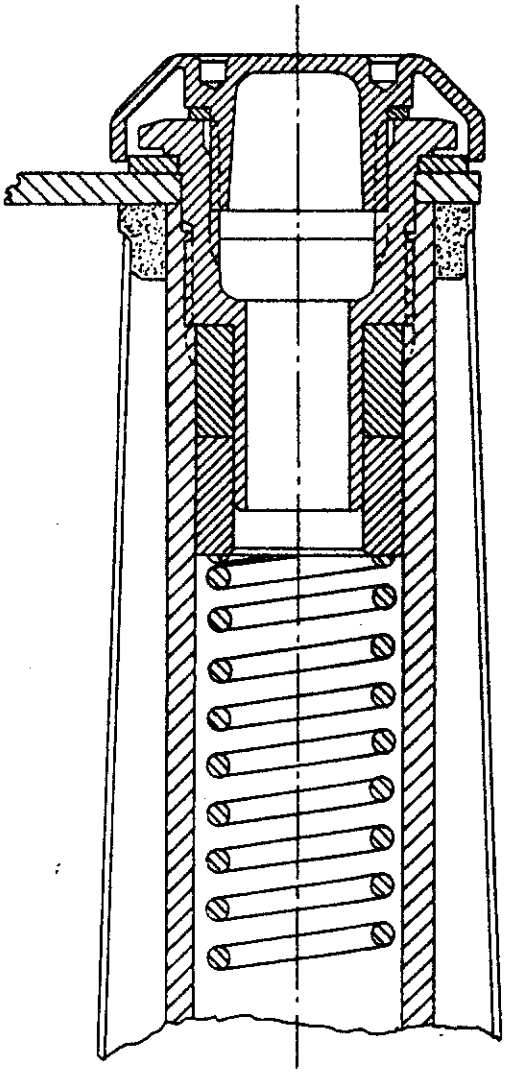

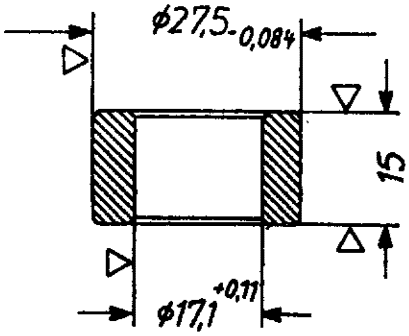
ϕ27,5-0,084
15
ϕ17,1+0,11