

Service-Information Motorcycle



BMW NA
Service Department

Group: 34
Brakes

August, 1992
34 028 92
(2545)

For USA Only


Brake Hose - R100R

Problem: On some R100R models the brake hose is too short and may rub against the fuel tank when the handlebars are at full lock.

This does not present a safety risk.

However, the brake hose may rub the painted finish on the tank.

Remedy: Starting with VIN 0280250, a longer hose has been fitted to all R100R models. The correct brake hose length is 745 ± 5 mm.

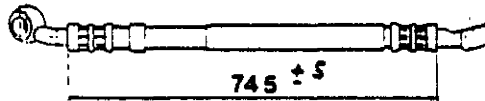

Part Number - 34 32 2 312 443

Warranty

Status: Parts and labor are reimbursable under the provisions of the BMW Limited Motorcycle Warranty of Three (3) Years / Unlimited Miles, using a normal Warranty Claim Form.

Defect Code Number - 34 32 0 017 700

Flat Rate Code - 34 32 381

Flat Rates - 6 FR

Very truly yours,

BMW of North America, Inc.

Frank Stevens
National Service Manager
Motorcycle Group

Richard Dampf
National Technical Manager

FS:tb/165.7

Please initial and route to the following before filing				
Service	Parts	Sales	Warranty	Technicians