

Service-Information



Group 33 Rear Drive	September 1979	Bulletin No. 33 004 79(2004)
------------------------	-------------------	----------------------------------

- For U.S.A. and Canada Only -

Subject: Types of Rear Shocks, BMW R 50/5 to
R 100 RT, Including R 65


Below find a listing of all rear shocks in use and optional equipment for your quick reference. It also informs you of a heavy-duty shock and its identification.

	Rate (N)	Identification	Part Number
Class I	290-360	"1" No. stamped into flat spot (see drawing on Page 2.)	R 65 33 53 1 240 647 R 50/5-R 100 RT 33 53 1 240 646
Class II	240-310	No identification mark.	R 65 33 53 1 240 616 R 50/5-R 100 RT 33 53 1 240 615
Heavy-Duty	290-410	R 65 - Blue Paint Dot on housing R 50/5-R 100 RT Red Paint Dot on housing	R 65 33 53 1 237 289 R 50/5-R 100 RT 33 53 1 231 498

Cont.....

Bulletin No.
33 004 79(2004)

STANDARD SHOCK ABSORBER

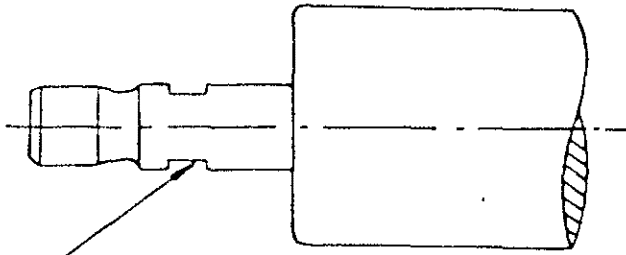

Identification Mark: 1

Caution: Only install shocks in pairs or with the identical identification marks. This service information replaced S.I. 33 002 77(1054R).

Yours truly,

BMW MOTORRAD GMBH
After-Sales Service