


# Service-Information

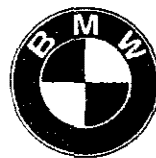

Group 71 Accessories	February 1980	Bulletin No.: 71 001 80(2014)
-------------------------	------------------	----------------------------------

- For U.S.A. and Canada Only -

Subject: Special Accessory Item - BMW Multipurpose Light,  
Part No. 72 60 1 239 446

Some operating faults have occurred from time to time when this multipurpose light is in use, with the result that the manufacturers have now improved the connector plug.

In the event of a complaint that the multipurpose light does not operate properly when plugged into the socket on the motorcycle, replace the complete connecting cable by an improved version:

Part No. 72 60 1 239 448.

If the warranty is valid, the cost of the replacement cable can be claimed by the usual procedure.

To replace the connecting cable:

- Fold up both covers on the multipurpose light.
- Using the thumbs, carefully press the halogen bulb with reflector out of the three retaining clips.
- Pull the plug with connecting cable out of the side of the body.
- Connect the new cable into position and re-assemble in the reverse order.

BMW MOTORRAD GMBH  
After-Sales Service  
Munich